

Building Manager: [Mohammad Azizian, mohammad.azizian@oregonstate.edu](mailto:mohammad.azizian@oregonstate.edu)
 Assessment Date: 5/4/2022
 Assessment Number: **10574**
 Location: Merryfield Hall Entire
 Reinspection date:

A joint fire safety inspection of the facility listed above was performed by the Environmental Health & Safety - Fire and Life Safety and the Corvallis Fire Department. These fire safety deficiencies could result in a fire or jeopardize the safety of those occupying the facility. Please see that these items are corrected immediately and no later than the scheduled reinspection date noted with this report. If you have any questions regarding this inspection, please email Brian Lilley (EH&S - Fire and Life Safety) at brian.lilley@oregonstate.edu.

Note: Deficiencies that are bold and underlined remain uncorrected from the last fire/life safety inspection(s) and should be corrected immediately.

* Annotates a deficiency identified by the Corvallis Fire Department.

Indicated on the report are items which should be corrected by the Departments (DEPT) that occupy this building, Facilities Services (FS), Environmental Health & Safety (EHS), and Recycling (RECY). Please forward a copy of this report to the responsible group(s) and begin corrective action so that all deficiencies have been corrected prior to the reinspection date. If assistance is required from Facilities Services to estimate or correct an item assigned to a Department, contact the Work Coordination Center at ext. 7-2969.

Facilities Services Priority Codes:

Priority 1: items are considered immediate safety hazards and should be corrected within 48 hours of notification if possible. If repairs cannot be made immediately, temporary measures may be taken.

Priority 2: items should be corrected within the five-week period before the scheduled reinspections.

Priority 3: items are long term fixes that should be either added to an ongoing work list or to the capital improvement list for campus upgrades.

Comments:

Priority code	Standard in need of attention	Reg.Reference	Location	Resp	Observations & Recommendations	Date Corrected
2	A means of egress shall be free from obstructions that would prevent its use. Combustible materials shall not be stored in exit pathways.	2019 OFC 1031.3 and 315.3.2	0103A:exit	DEPT	Remove items from exit door and do not block.	

Priority
code

Standard in need of attention


Reg.Reference

Location

Resp

Observations & Recommendations

[Date Corrected](#)

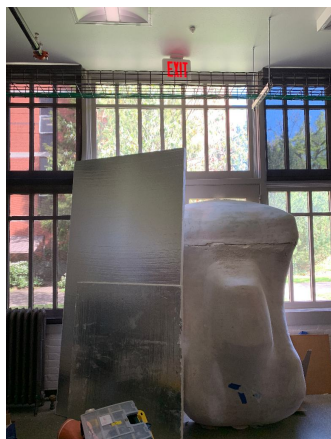

Room 103A Blocked Exit Door

3

Door operating devices shall not require tight grasping, tight pinching or twisting of the wrist to operate.

2019 OFC 1010.1.9.1

Various:throughout

EHS

Replace round knob door handles in spaces
(CURRENTLY UNDER EH&S REVIEW):


- 1) Second floor west exit
- 2) Room 103A



Second Floor West Exit

Priority code	Standard in need of attention	Reg.Reference	Location	Resp	Observations & Recommendations	Date Corrected
----------------------	--------------------------------------	----------------------	-----------------	-------------	---	---------------------------------------

2	All sprinkler valves shall be supervised/locked in the open position, accessible, and unobstructed. Door to control room shall be identified.	2019 OFC 901.4.6.1 and 903.3.8.4	117:entrance	FS	Provide fire sprinkler riser room sign for door.	
---	---	----------------------------------	--------------	----	--	--

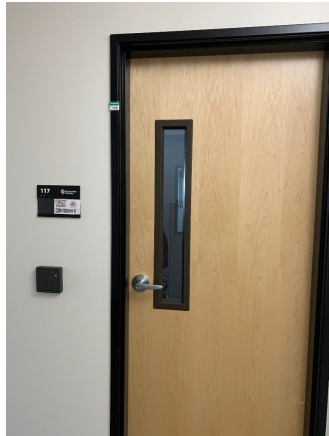

Room 117

2	Materials susceptible to spontaneous ignition, such as oily rags, shall be stored in a listed disposal container. Contents shall be disposed of daily.	2019 OFC 304.3.1	0110A:inside	DEPT	Empty oily rag bucket on a daily basis.	
---	--	------------------	--------------	------	---	--



Room 110A

Priority code	Standard in need of attention	Reg.Reference	Location	Resp	Observations & Recommendations	Date Corrected
----------------------	--------------------------------------	----------------------	-----------------	-------------	---	---------------------------------------

2	A working space of not less than 36 inches in front of electrical service equipment shall be maintained. Storage of materials shall not be located within this space.	2019 OFC 604.3.1	0103A:inside	DEPT	Keep electrical panel clear from combustibles and do no block.	
---	---	------------------	--------------	------	--	--



Room 103A

2	Additional Findings:		0109:and 0109A	FS	Repair/replace ceiling tiles in spaces: 1) 109 2) 109A	
---	----------------------	--	----------------	----	--	--