

Building Manager: [Laura Tilley, laura.tilley@oregonstate.edu](mailto:laura.tilley@oregonstate.edu)  
 Assessment Date: 1/4/2022  
 Assessment Number: **10504**  
 Location: Snell Hall (MU East) Entire  
 Reinspection date:

A joint fire safety inspection of the facility listed above was performed by the Environmental Health & Safety - Fire and Life Safety and the Corvallis Fire Department. These fire safety deficiencies could result in a fire or jeopardize the safety of those occupying the facility. Please see that these items are corrected immediately and no later than the scheduled reinspection date noted with this report. If you have any questions regarding this inspection, please email Brian Lilley (EH&S - Fire and Life Safety) at [brian.lilley@oregonstate.edu](mailto:brian.lilley@oregonstate.edu).

**Note: Deficiencies that are bold and underlined remain uncorrected from the last fire/life safety inspection(s) and should be corrected immediately.**

\* Annotates a deficiency identified by the Corvallis Fire Department.

Indicated on the report are items which should be corrected by the Departments (DEPT) that occupy this building, Facilities Services (FS), Environmental Health & Safety (EHS), and Recycling (RECY). Please forward a copy of this report to the responsible group(s) and begin corrective action so that all deficiencies have been corrected prior to the reinspection date. If assistance is required from Facilities Services to estimate or correct an item assigned to a Department, contact the Work Coordination Center at ext. 7-2969.

**Facilities Services Priority Codes:**

**Priority 1:** items are considered immediate safety hazards and should be corrected within 48 hours of notification if possible. If repairs cannot be made immediately, temporary measures may be taken.

**Priority 2:** items should be corrected within the five-week period before the scheduled reinspections.

**Priority 3:** items are long term fixes that should be either added to an ongoing work list or to the capital improvement list for campus upgrades.

**Comments:**


<b>Priority code</b>	<b>Standard in need of attention</b>	<b>Reg.Reference</b>	<b>Location</b>	<b>Resp</b>	<b>Observations &amp; Recommendations</b>	<b><a href="#">Date Corrected</a></b>
2	Door operating devices shall not require tight grasping, tight pinching or twisting of the wrist to operate.	2019 OFC 1010.1.9.1	Throughout:exit	FS	ALL doors leading out of building must be a lever-style handle and NOT a round knob.	

Priority code	Standard in need of attention	Reg.Reference	Location	Resp	Observations & Recommendations	Date Corrected
---------------	-------------------------------	---------------	----------	------	--------------------------------	----------------



Door Knobs

2	Provide approved exit door hardware and/or maintain exit door.	2019 OFC 1010	South Side:exit	FS	5th floor south side door catches on ground when exiting from office spaces.5t	
2	All sprinkler valves shall be supervised/locked in the open position, accessible, and unobstructed. Door to control room shall be identified.	2019 OFC 901.4.6.1 and 903.3.8.4	44:inside	DEPT	Provide clearance to sprinkler control valves.	

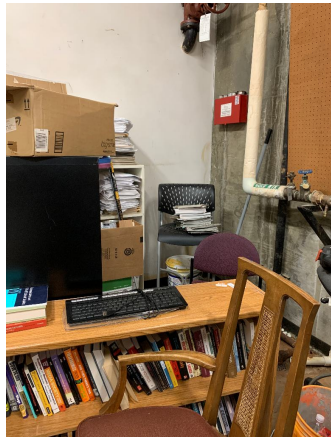

Room 44

Priority code	Standard in need of attention	Reg.Reference	Location	Resp	Observations & Recommendations	Date Corrected
2	Discontinue use of extension cord not plugged directly into an approved receptacle. Do not chain together.	2019 OFC 604.5.1	073:inside	DEPT	Discontinue plugging printer into extension cords. Plug printer directly into wall outlet.	



Room 0073